



SERVICE BULLETIN # 00131

201 INDUSTRIAL BOULEVARD • KEARNEYSVILLE, WV 25430

Phone: (304) 728-7056 • Fax: (304) 725-6579 • Toll Free: (800) 931-9214

PAGE: 1 of 1

DATE: 6-19-02

REVISION: 04

SUBJECT: Potential "Lock-Up" With NovRAM Devices in GII Version 2 Control Boards

MODELS: GIIv2 or GIII Venders Built Prior to Production Run #1344

KIT NUMBER	KIT DESCRIPTION
Coinco	NovRAM Device



The following areas of this vender contain voltage, which can cause serious injury or even death. The main power cord, supplying 110 VAC to the evaporator, EMI filter, and refrigeration system. The power line from the EMI filter to the ballast and transformer. The ballast can produce upwards of 600 volts. Remove power from vender before working in any of these

Reason For Fix:

The NovRAM device with "DALLAS" on them could potentially lock, denying any access and causing the L.E.D. display to register



Instructions:

1. Remove power from vender by unplugging vender's main power cord from the AC voltage power source (wall outlet).
2. Access the controller board by removing the two screws that secure the control board's cover.
3. Using a small screwdriver, remove the NovRAM device from it's socket. The NovRAM is the upper left most chip on the controller board as it is mounted in the vender (see illustration).

NOTE: Pay close attention to the direction in which the NovRam is installed and install the new one in the same direction. (Match the semi-circle on one end of the NovRam to the one on the controller board NovRAM socket. see illustration)


4. With the new NovRAM installed, reapply power to the controller board and note that the L.E.D. lights should display the proper greeting.

NOTE: It is necessary that the controller board be reconfigured to the same setting that it had been originally. ie. space to sales, vend price, column depth. Refer to set up instruction sheets.

5. Reinstall the controller board cover and test for proper operation.

NovRAMs can be ordered from your nearest Coin Acceptors office or by calling:

Coin Acceptors, Inc.
300 Hunter Avenue
St. Louis, Missouri, 63124
314-725-0100 Attn: Field Service

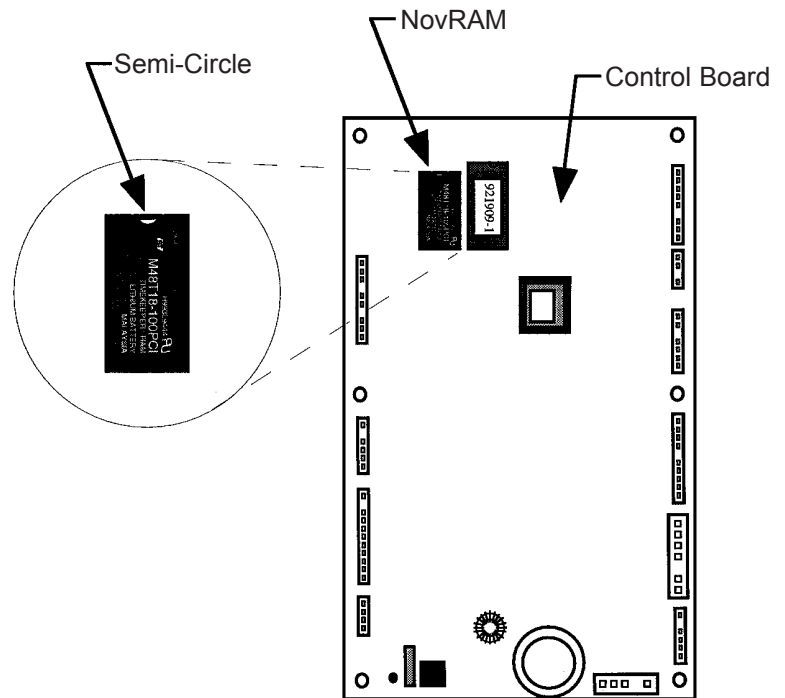

FOR ADDITIONAL INFORMATION, PLEASE CONTACT YOUR NEAREST COIN ACCEPTORS BRANCH OFFICE.