



SERVICE BULLETIN # 00181

201 INDUSTRIAL BOULEVARD • KEARNEYSVILLE, WV 25430

Phone: (304) 728-7056 • Fax: (304) 725-6579 • Toll Free: (800) 931-9214

PAGE: 1 of 1

DATE: 8-22-00

REVISION: 01

SUBJECT: Marketing Venders with "Cracked" Thirsty Lexan Signs

MODELS: Marketing Venders prior to P.O. 1526B

KIT NUMBER

KIT DESCRIPTION

290140


Marketing P.O.S. Window Kit (1520B and prior - including 1530B)

290142

Marketing P.O.S. Window Kit (1521B through 1526B - including 1540B)

Instructions:

1. Remove power from vender by unplugging vender's main power cord from the AC voltage power source (wall outlet).
2. Remove Validator (4 nuts and harness).
3. Remove Validator divider (5 carriage bolts - 2 on top, 3 on bottom).
4. Remove florescent light bulb (refer to Service Bulletin 173).
5. Remove original "Thirsty" Lexan sign by removing all 8 nuts off of the thread studs.
6. Remove the current gasket on the control panel before applying the new gasket.
7. Apply 3-sided gasket (with long piece on bottom) on the control panel.
8. Install the P.O.S. window over the thread studs with the tab on the left facing you .
9. Put the metal window plate over the window with the angled end on the left, and the bent edge facing towards you.
10. Tighten down nuts on thread studs.
11. Reinstall Validator if present (4 nuts and harness).

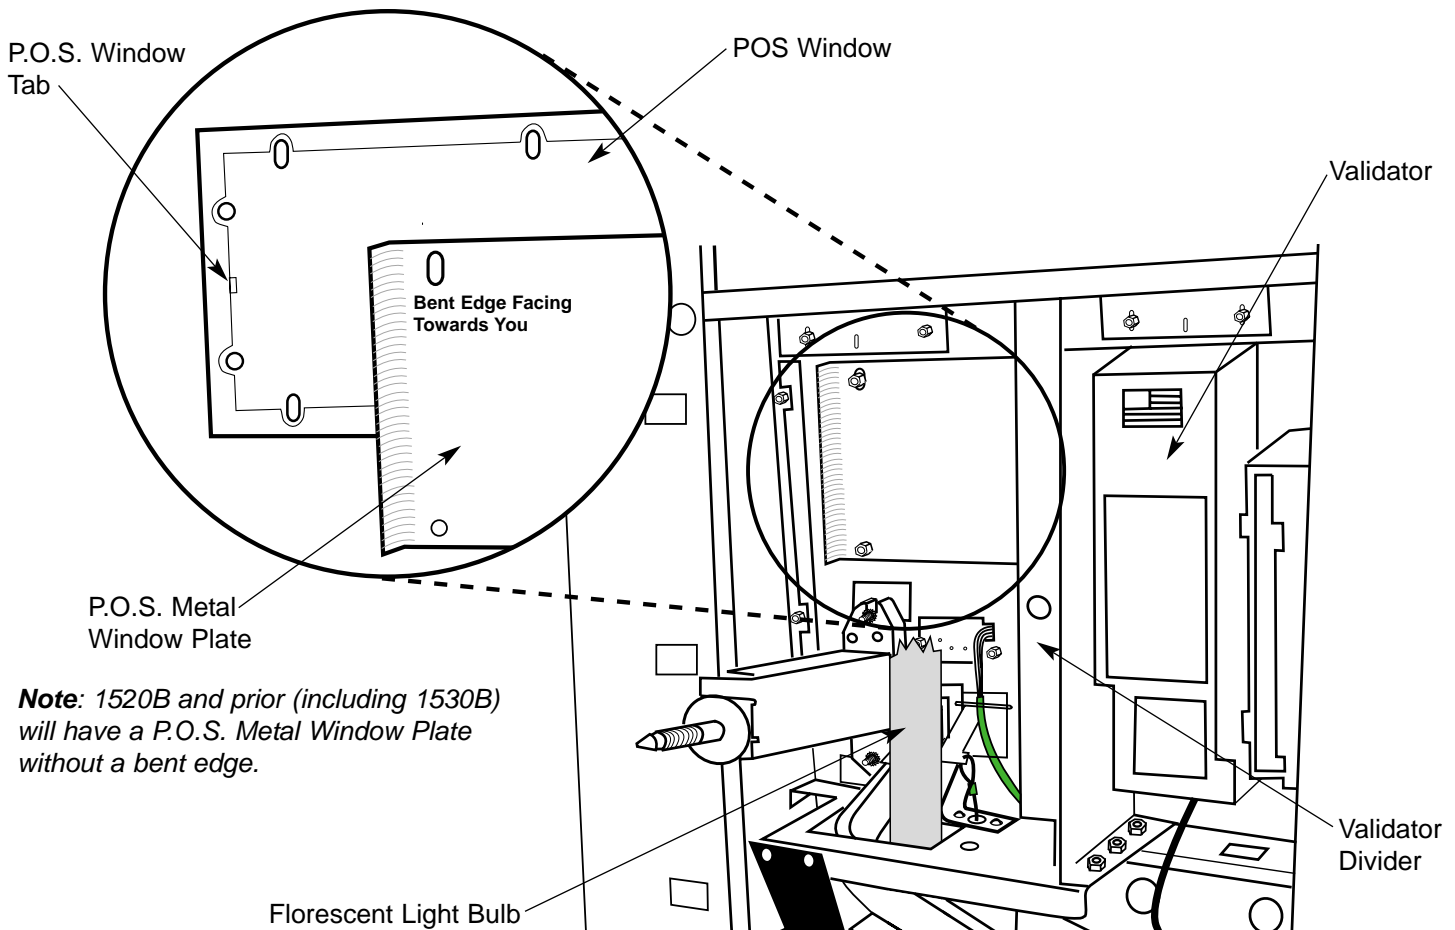

ANY QUESTIONS??? CONTACT ROYAL VENDORS' CUSTOMER SERVICE DEPARTMENT
CALL TOLL FREE (800) 931-9214