



# SERVICE BULLETIN # 00140

201 INDUSTRIAL BOULEVARD • KEARNEYSVILLE, WV 25430

Phone: (304) 728-7056 • Fax: (304) 725-6579 • Toll Free: (800) 931-9214

PAGE: 1 of 3

DATE: 8-21-00

REVISION: 03

**SUBJECT:** Installation of 20 oz. "Straight-Wall" Plastic Bottle Bridging in GII Venders

**MODELS:** 804-9 & 660-9 (GIII Models)

**KIT NUMBER**

**KIT DESCRIPTION**

210120

Anti Bridging Kit, GIII (1 Kit Needed Per Column)

**BEFORE WORKING ON VENDER:** Remove power from vender by unplugging vender's main power cord from the AC voltage power source (wall outlet).

### *Reason For Fix:*

We have experienced "Bridging" with 20 oz. bottles on some early production GIII venders.

### *Instructions:*

1. Unload column to be retrofitted.
2. Peel the backing from the 3 pieces of the "two-sided" tape on the rear of the 3 padded metal sheets.
3. Place the 3 padded metal sheets on the column wall against the center channel (divider between the front and rear columns). Make sure that the edge of the 3 padded metal sheets with 1/2" of metal exposed is aligned against the center channel as shown in the diagrams on page 2 and 3 of this bulletin. Locate the bottom edge of the sheet approximately 1" above the bottom product retainer slots on both right and left column walls as shown in the diagrams on page 2 and 3 of this bulletin.

**ANY QUESTIONS???** CONTACT ROYAL VENDORS' CUSTOMER SERVICE DEPARTMENT  
CALL TOLL FREE (800) 931-9214



# SERVICE BULLETIN # 00140


201 INDUSTRIAL BOULEVARD • KEARNEYSVILLE, WV 25430  
Phone: (304) 728-7056 • Fax: (304) 725-6579 • Toll Free: (800) 931-9214

<b>PAGE:</b> 2 of 3
<b>DATE:</b> 8-21-00
<b>REVISION:</b> 03

**SUBJECT:** Installation of 20 oz. "Straight-Wall" Plastic Bottle Bridging in GII Venders

**MODELS:** 804-9 & 660-9 (GIII (1 Kit Needed Per Column))

## Left Column Wall

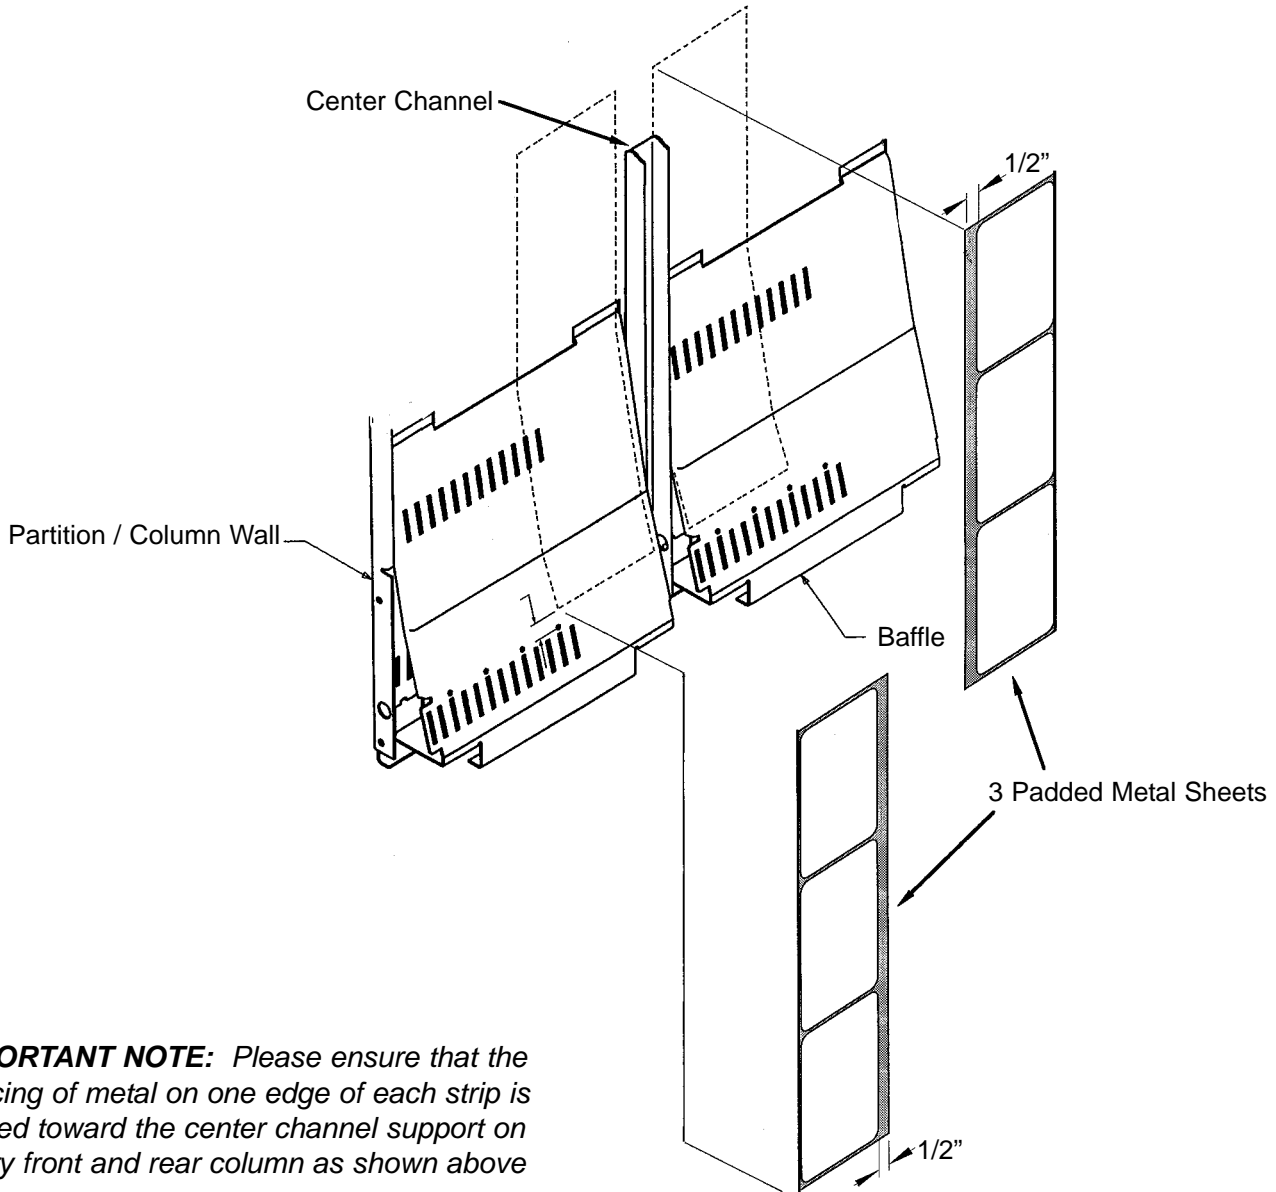

**IMPORTANT NOTE:** Please ensure that the spacing of metal on one edge of each strip is placed toward the center channel support on every front and rear column as shown above

**ANY QUESTIONS???** CONTACT ROYAL VENDORS' CUSTOMER SERVICE DEPARTMENT  
CALL TOLL FREE (800) 931-9214



# SERVICE BULLETIN # 00140

201 INDUSTRIAL BOULEVARD • KEARNEYSVILLE, WV 25430

Phone: (304) 728-7056 • Fax: (304) 725-6579 • Toll Free: (800) 931-9214

PAGE: 3 of 3


DATE: 8-21-00

REVISION: 03

**SUBJECT:** Installation of 20 oz. "Straight-Wall" Plastic Bottle Bridging in GII Venders

**MODELS:** 804-9 & 660-9 (GIII (1 Kit Needed Per Column))

## Right Column Wall

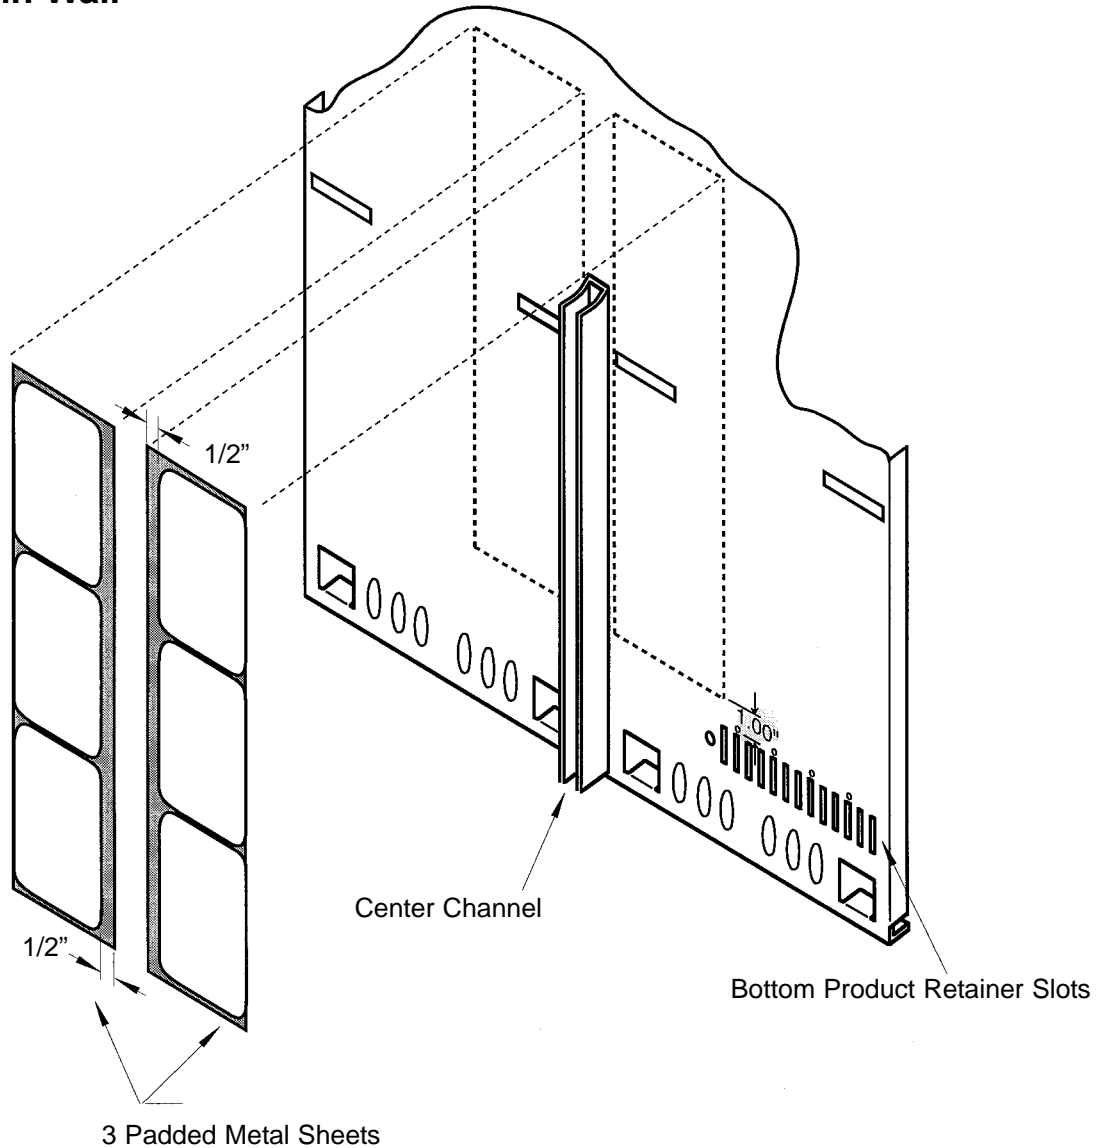

**IMPORTANT NOTE:** Please ensure that the 1/2" spacing of metal on one edge of each strip is placed toward the center channel support on every front and rear column as shown above.

**ANY QUESTIONS???** CONTACT ROYAL VENDORS' CUSTOMER SERVICE DEPARTMENT  
CALL TOLL FREE (800) 931-9214